



18V BRUSHLESS FULL AUTO SHUT-OFF CORDLESS ANGLE SCREWDRIVER & WRENCH



Angle head can be adjusted through 360° by 45° turns in 8 equal positions

Colorful torque ring easily distinguish the torque virtually



Friendly Design

LED light for working in dark area



Internal Torque Adjustment

Hanger Ring



Automatic shut-off clutch with high precision torque

Brushless Motor

(Environmental Friendly)

High & Low Speed switch to extend the application

One-Hand operation

Easy to switch Forward/Reverse

Power light

LED signal light

PCB control protection

Waist Hook

The performance with fully charged battery can reach to 560 screws on loading 60 Nm (EAW-B1860-40)

Wrist Strap



18V BRUSHLESS FULL AUTO SHUT-OFF CORDLESS ANGLE SCREWDRIVER & WRENCH

Protection & safety:

- 1 Over electric current protection.
- 2 Slow rotation protection.
- 3 Reverse control protection.
- 4 Battery Self-identified & Sleep mode (Energy saved).
- 5 Low power protection.
- 6 Thermal protection.
- 7 Stall protection.



Charger

- Identification Of Original Battery Device:
identify whether the battery is original or not, if not, the battery can not be charged. (BC21L01, BC21L03)




BC21L01
21 Voltage Charger
Weight : 1.21kg



BC21L02
Weight : 0.53kg
BC21L03
Weight : 0.55kg
21 Voltage Charger



BC21L04
21 Voltage Charger
Weight : 0.53kg

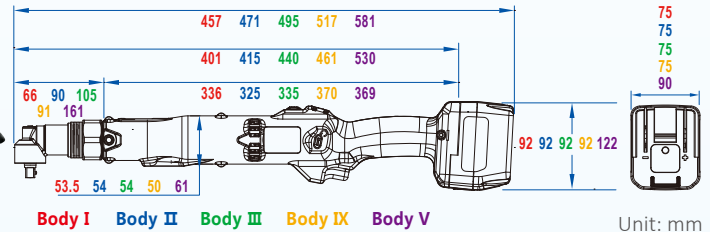

Specification:

| Model No. | Voltage (V) | Free Speed (r.p.m) | | Torque Range (Accuracy±5%) | | | Weight (w/o Battery) | | Dimension (WxLxH) (mm) | Battery Pack | Option Charger | Standard Type | Option Type |
|-----------------|-------------|--------------------|-----|----------------------------|-------|---------|----------------------|------|------------------------|--------------|--------------------|---------------------|---------------------|
| | | High | Low | in-lbs | Nm | Kgf/cm | lbs | kg | | | | | |
| Body I | | | | | | | | | | | | | |
| EAS-B1805H-20 | 18 | 1,200 | 800 | 17.7~44.3 | 2~5 | 20~50 | 2.76 | 1.25 | 75x457x92 | BP1820L | BC21L01 | B Hex 6.35mm | A Hex 5mm |
| EAS-B1807-20 | 18 | 850 | 550 | 22.1~62.0 | 2.5~7 | 25~70 | 2.76 | 1.25 | 75x457x92 | BP1820L | | | |
| Body II | | | | | | | | | | | | | |
| EAS-B1812-20 | 18 | 550 | 350 | 53.1~106.2 | 6~12 | 60~120 | 3.31 | 1.5 | 75x471x92 | BP1820L | BC21L04 | W Square Drive 3/8" | 9.5 |
| EAS-B1815-20 | 18 | 350 | 220 | 70.9~132.8 | 8~15 | 80~150 | 4.19 | 1.5 | 75x471x92 | BP1820L | | | |
| Body III | | | | | | | | | | | | | |
| EAS-B1808H-20 | 18 | 1200 | 800 | 26.6~70.8 | 3~8 | 30~80 | 4.19 | 1.9 | 75x495x92 | BP1822L | BC21L01 | B Hex 6.35mm | W Square Drive 3/8" |
| EAS-B1815H-20 | 18 | 800 | 550 | 70.9~132.8 | 8~15 | 80~150 | 4.19 | 1.9 | 75x495x92 | BP1822L | | | |
| Body IX | | | | | | | | | | | | | |
| EAW-B1830-20 | 18 | 420 | 270 | 106.2~265.5 | 12~30 | 120~300 | 4.19 | 1.9 | 75x517x92 | BP1822L | BC21L04 | W Square Drive 3/8" | - |
| Body V | | | | | | | | | | | | | |
| EAW-B1845-40 | 18 | 200 | 130 | 132.8~398.3 | 15~45 | 150~450 | 6.27 | 2.85 | 90x581x122 | BP1841L | BC21L01 | W Square Drive 1/2" | - |
| EAW-B1860-40 | 18 | 200 | 130 | 221.3~531.1 | 25~60 | 250~600 | 6.27 | 2.85 | 90x581x122 | BP1841L | BC21L02 BC21L03 | W Square Drive 1/2" | - |

*Free load speed will be fixed when battery volume is more than 17V (17~21V).